

SCT-4X Series

Firmware version 01.21.01

Webserver Manual



© Rice Lake Weighing Systems. All rights reserved.

Rice Lake Weighing Systems® is a registered trademark of
Rice Lake Weighing Systems.

All other brand or product names within this publication are trademarks or
registered trademarks of their respective companies.

All information contained within this publication is, to the best of our knowledge, complete and accurate at the
time of publication. Rice Lake Weighing Systems reserves the right to make changes to the technology, features,
specifications and design of the equipment without notice.

The most current version of this publication, software, firmware and all other product
updates can be found on our website:

www.ricelake.com

Table of Contents

Introduction	4
Network Connection	4
Network Parameters	5
Web Page Login	5
Main Screen	6
Operating Mode	7
Network Configuration	7
Backup/Restore	8
Change Password	8
Indicator Reboot	8
Sign Out	8
Instrument Information	9
Zero	9
Tare	9
A/D Conversion Points	9
Calibration Parameters	9
By Indicator Calibration (By Indicator is Enabled)	10
Web Server Calibration (By Indicator is Disabled)	10
Calibration	10
Commands	10
Theoretical Calibration	11
Filter	11

Introduction

Thank you for purchasing this product.

This manual contains webserver information for the following SCT-4SX digital weight transmitters:

- SCT-4X-ETHIP
- SCT-4X-MODTCP
- SCT-4X-PRONET

It is recommended that you carefully follow the instructions for programming the weight transmitter; performing actions not indicated in this manual could compromise the functionality of the scale.




Manuals are available from Rice Lake Weighing Systems at www.ricelake.com/manuals
Warranty information is available at www.ricelake.com/warranties

Report any product problems to the manufacturer or to the retailer where it was purchased.
Always TURN OFF THE POWER SUPPLY prior to installation or repair action.

Network Connection

Connect the instrument to the network using either of the available Ethernet ports:

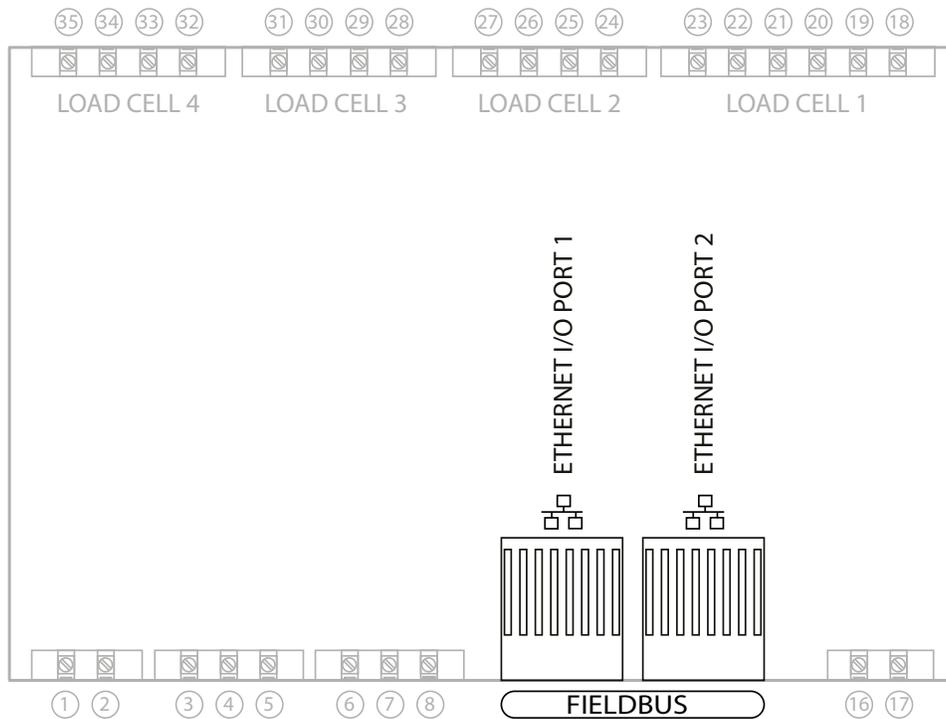

Network Parameters

Use the **Fieldbus Settings** procedure in the instrument's Quick Start Guide to configure the IP address, subnet mask and gateway of the instrument.

In most applications it is sufficient to set the IP address of the instrument to the same network ID as the PC. Ensure the configured device ID is not used by another device on the network.



For advanced configuration, contact your network administrator.

Web Page Login

Connect a device to the same network as SCT4X. Type the IP address of the instrument into a web browser. If the instrument has been configured correctly, the login window displays:

Ethernet/IP module
SN

Password

Sign in

Read Only

Warning: signing in with read only unchecked will prevent Fieldbus master to send commands to indicator until sign out

Enter the password "00000" and sign in.



Once logged in, it is possible to change the password (**Change password**). In case of lost password contact Rice Lake Weighing Systems for recovery.



Only one PC is allowed to access the instrument's web page at a time, if you login from a second PC, the first one will be automatically disconnected.



Logging into the instrument with Read Only disabled interrupts the communication with the PLC.

When Read Only is enabled, the following features are restricted: accessing load cells, Calibration, Operative mode and Indicator reboot.

Independent Channels Mode (Multi-Scale)

1 Operative Mode 2 Network configuration 3 Backup/Restore 4 Change password 5 Indicator reboot 6 Sign out Release 8.0

Fieldbus	Profinet	SN	22625	Fw release	1.19	Ind. SN	34306983	8
ID	GROSS	NET	TARE	UNIT	STATUS	ZERO	TARE	
1	508	508	0	kg	~ >0< UL OL IN1 IN2 OUT1 OUT2			
2	672	508	0	kg	~ >0< UL OL IN1 IN2 OUT1 OUT2			
3	3200	3100	100	kg	~ >0< UL OL IN1 IN2 OUT1 OUT2			
4	25.8	23.5	2.3	g	~ >0< UL OL IN1 IN2 OUT1 OUT2			9

Dependent / independent channels mode (single scale)

1 Operative Mode 2 Network configuration 3 Backup/Restore 4 Change password 5 Indicator reboot 6 Sign out Release 8.0

Fieldbus	Ethernet/IP	SN	22625	Fw release	1.121	Ind. SN	25145725	8
ID	GROSS	NET	TARE	UNIT	STATUS	ZERO	TARE	
1	508	508	0	kg	~ >0< UL OL IN1 IN2 OUT1 OUT2			

7

10 ADC 123456 12 13 9

PARAMETERS	CALIBRATION	COMMANDS
Unit: kg	Cal. points: 1	WRITE PARAMETERS
Decimals: 0	<input checked="" type="checkbox"/> By indicator <input checked="" type="checkbox"/> Check stability	ABORT CALIBRATION
Capacity 1: 10000	Weight: ADC mV/V	END CALIBRATION
Capacity 2: 0	Zero: 0 0	ZERO CALIBRATION
Division 1: 1	Point 1: 10000 2147484 1.78348	THEOR. CALIB.
Division 2:	Point 2: 0 0 0	
	Point 3: 0 0 0	

11

FILTER
FILTER: F6
RATE: 200
PARAM. 1: 30
PARAM. 2: 16
PARAM. 3: 2

15

1 Operating Mode

Read or configure operating modes. Settings include:

- Operative mode: Dependent or Independent
- Channels: Channel number (1, 2, 3, 4)
- Digital Cells: Type 1-5 or Analog
- Excluded Channels: Excluded Channel number (1, 2, 3, 4)

Profinet module SN
22625

Password

Operative mode

Channels

Digital Cells

Excluded channel

2 Network Configuration

Edit the network parameters and the displayed data format:

- IP address, Subnet mask, Gateway (enable "Auto config." for DHCP).
- Byte order: Big endian / Little endian. This parameter configures device compatible with different processors. It reverses the byte order of input and the output data.
- Data format: Unsigned integer / Signed integer / Float.
- Name of station: up to 16 characters (only SCT-4X-PRONET)

Profinet module SN
22625

Password

Auto config

IP address

Subnet mask

Gateway

Byte order

Data format

Name of station

i Changing the parameters will disconnect the transmitter. To reconnect, you must enter the new IP address in the web browser.

(only SCT-4X-PRONET)

3 Backup/Restore

Select "**Backup Configuration**" to start receiving the instrument configuration in the web browser. When reception is complete, the "**setup.mot**" file automatically downloads. This file is compatible with the Rice Lake Tools.

Select "**Restore Configuration**" to choose a configuration file to load on the instrument.

WARNING: the configuration file must have ".mot" extension.

Ethernet/IP module SN
22625

4 Change Password

To change an account's password:

- Enter your old password.
- Enter new password and then confirm.
- Select Change password to complete the procedure.

Profinet module SN
22625

5 Indicator Reboot

Reboots the indicator.

6 Sign Out

Signs out from the instrument's web page.

7 Instrument Information

Displays the scale's weight and status information. If more than one scale is configured, select to open parameters.

ID	Scale identification number (only for <i>ind. [h]</i> mode)
GROSS	Gross weight
NET	Net weight
TARE	Tare
UNIT	Unit of measure
STATUS	Instrument status
	~ Unstable weight
	>0< Gross weight equal to zero
	UL Underload
	OL Overload
	IN1 Input 1 active
	IN2 Input 2 active
	OUT1 Output 1 active
OUT2 Output 2 active	

8 Zero

Zeros the instrument.

WARNING: The zero execution takes place only if the necessary conditions are met (zero parameters).

9 Tare

Performs a tare on the instrument.

To clear an active tare, you must perform a new tare when the scale is empty.

10 A/D Conversion Points

In *dEP. [h]* mode, the sum of the active channels is displayed.

In *ind. [h]* mode the value of the active scale is displayed.

11 Calibration Parameters

Sets the scale calibration parameters:

Unit	Unit of measure (g, kg, t, lb)
Decimals	Number of decimal places (0, 1, 2, 3)
Capacity 1	First range value (or full capacity for single range applications)
Capacity 2	Second range value (not used in single range applications)
Division 1	First range division (1, 2, 5, 10, 20, 50)
Division 2	Second range division (1, 2, 5, 10, 20, 50)

12 Calibration

NOTE: When By indicator is enabled, calibration uses the indicator settings. When By indicator is disabled, it uses the settings on the web server.

By Indicator Calibration (By Indicator is Enabled)

1. Enable the By indicator checkbox.
2. In the Parameters menu, set Unit, Decimals, Capacity, and Division parameters.
3. In the Calibration menu, set the number of calibration points and then enter their weight values in the corresponding Weight text boxes.
4. Select **WRITE PARAMETERS** to send to parameters to the indicator (units, decimals, capacities, divisions, number of calibration points and sample weights).
5. Unload the scale and then select Zero.
6. Load the platform with sample weight 1 and select Point 1. The value of ADC points is automatically acquired in the text box on the right. If you know the ADC point value, it can be entered manually.
7. Repeat 5 and 6 for the remaining calibration points. The weight and ADC point values must increase with each calibration point:
8. Select **END CALIBRATION** to save the calibration.

Web Server Calibration (By Indicator is Disabled)

1. Disable the By indicator checkbox.
2. In the Parameters menu, set Unit, Decimals, Capacity, and Division parameters.
3. In the Calibration menu, set the number of calibration points and then enter their weight values in the corresponding Weight text boxes.
4. Unload the scale and then select Zero.
5. Load the platform with sample weight 1 and select Point 1. The value of ADC points is automatically acquired in the text box on the right. If you know the ADC point value, it can be entered manually.
6. Repeat 4 and 5 for the remaining calibration points. The weight and ADC point values must increase with each calibration point:
7. Select **WRITE PARAMETERS** to save all parameters on the indicator.



If the weight and/or ADC values are not increasing (Case 2), only point 1 will be considered.

If "Check stability" is active, the calibration points are only acquired if the weight is stable.

Case 1

CALIBRATION			
Cal. points	1	<input checked="" type="checkbox"/> By indicator	<input checked="" type="checkbox"/> Check stability
	Weight	ADC	mV/V
Zero		0	0
Point 1	2000	647484	0.22491
Point 2	4000	1292501	0.78523
Point 3	10000	30741680	1.89348

Case 2

CALIBRATION			
Cal. points	1	<input checked="" type="checkbox"/> By indicator	<input checked="" type="checkbox"/> Check stability
	Weight	ADC	mV/V
Zero		0	0
Point 1	2000	647484	0.22491
Point 2	10000	30741680	1.89348
Point 3	4000	1292501	0.78523

14 Commands

WRITE PARAMETERS	Saves parameters to the indicator.
ABORT CALIBRATION	Cancels calibration without saving.
END CALIBRATION	After acquisition sequence ends calibration and saves values on indicator. NOTE Only used when the By indicator checkbox is enabled.
ZERO CALIBRATION	Pre-Tare Reset
THOER. CALIBRATION	Theoretical calibration: By entering the weight and mV/V value of the cells the relative ADC points are calculated. .

15 Theoretical Calibration


1. Enter the value 0 in the zero mV/V box.
2. Enter in the mV/V box related to point 1, the cell sensitivity value calculated as shown in the note.
3. Calculate ADC points by clicking THEOR. CALIB.

DEPENDENT CHANNELS



mV/V value:
 $mV/V \text{ cell1} +$
 $mV/V \text{ cell2} +$
 $mV/V \text{ cell3} +$
 $mV/V \text{ cell4}$

INDEPENDENT CHANNELS

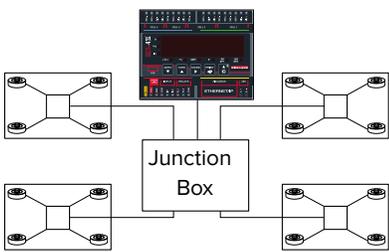

mV/V value:

$$\frac{mV/V \text{ cell1} + mV/V \text{ cell2} + \dots + mV/V \text{ cellN}}{N}$$
Repeat the procedure for each scale.

16 Filter

Filter	Configures filter (F1, F2, F3, F4, F5, F6, F7 or Custom). For more information, see instrument's operation manual.
Rate	Configures the number of analog to digital conversions (3-100) per second that is performed by the analog to digital converter.
Param. 1	Configures the length of the average window (quantity of ADC points). For example, a value of 8 indicates 8 ADC points will be used for the average window.
Param. 2	Removes ADC points from the average window in beginning or ending positions. For example, a value of 2 indicates the 2 outermost values will be removed from the list. In the list: 10, 20, 30 and 40; 10 and 40 are removed.
Param. 3	Removes the center most ADC points from average computations. For example, a value of 2 indicates the 2 center most values are removed from the list. In the list: 10, 20, 30 and 40; 20 and 30 are removed.

Parameter (Param.) values must meet the following the criteria:

- All parameters values must be even numbers
- Param. 2 must be less than or equal to param. 1 and greater than zero
- Param. 3 must be in the range zero to param. 2 - 2

Configure the following parameters to disable filtering:

- Param. 1 = 1
- Param. 2 = 0
- Param. 3 = 0



© Rice Lake Weighing Systems Content subject to change without notice.

230 W. Coleman St. • Rice Lake, WI 54868 • USA USA: 800-472-6703 • International: +1-715-234-9171