


MSI-8000 Menu Map

With the Power On, press the F2 key and Power key simultaneously

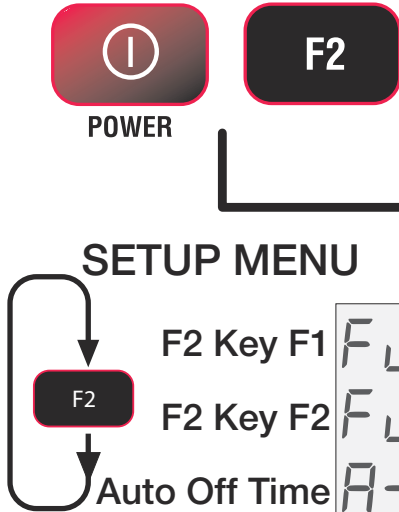

Func 1
Func 2
A-OFF

Disabled (default) OFF
15 minutes 15
30 minutes 30
45 minutes 45
1 hour 60

AUTO OFF TIME

F1 & F2 KEY FUNCTIONS

OFF	Off
tEST	Test Display
totAl	Total
v-ttL	View Total
nEtGr	Net/Gross
P-Hld	Peak Hold
2Un it	2 Units
5Un it	5 Units
H i r ES	Hi Res
Pr int	Print
tArE	Tare
ScAn	Scan
ttL.rd	Total Remote Devices



A RICE LAKE WEIGHING SYSTEMS COMPANY

14240 Interurban Avenue South, STE. 200, Seattle, Washington 98168-4661 U.S.A.
TEL: 206-433-0199 • FAX: 206-244-8470 • EMAIL: info@msiscales.com www.msiscales.com

© 2013 by Measurement Systems International, Inc PN 154731 4/13
Specifications subject to change without notice. Printed in U.S.A.